


REV.	DESCRIPTION	DATE	BY

TYPES AW & AWH-3E SPRING-FLEX MOUNTINGS				
MODEL	MAX LOAD ² (LBS)	DEFLECTION (IN)	SPRING RATE (LB/IN)	SPRING COLOR CODE
AW*-3E-1600 ¹	1600	3.00	533	DK GRAY
AW*-3E-2110 ¹	2110	2.53	833	DK YELLOW
AW*-3E-2440 ¹	2440	2.44	1000	RED
AW*-3E-3500 ¹	3500	2.63	1333	GREEN

NOTES:

- 1. TO COMPLETE MODEL NUMBER, ADD STYLE LETTER (IF USED) IN PLACE OF *.
- 2. LOAD WILL BE LABELED ON ISOLATOR AND STENCILED ON BASE PLATE.

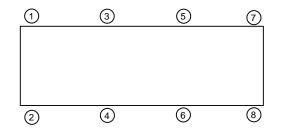

ISOLATOR SELECTIONS			
LOC 1:	LOC 2:		
LOC 3:	LOC 4:		
LOC 5:	LOC 6:		
LOC 7:	LOC 8:		
CUSTOMER EQP'T. TAG:	•		

NOTE: MATERIAL SHOWN IS FOR (1) SET.

NOTES:

- 1. ALL DIMENSIONS ARE IN INCHES. INTERPRET PER ANSI Y-14.
- 2. FINISH: HOUSING- ONE COAT BLACK PAINT, SPRING- BLACK PAINT, HARDWARE- ZINC ELECTROPLATE.
- 3. REFER TO DRAWING 2 OF 2 FOR INSTALLATION INSTRUCTIONS.
- 4. INNER SPRING (WHEN USED) NOT SHOWN.
- 5. ALL SPRINGS DESIGNED WITH 50% OVER-TRAVEL.
- 6. RATED DEFLECTIONS ARE WITHIN 25% OF NOMINAL.. HIGHER DEFLECTIONS ARE ALLOWED IF THEY MEET SPECIFICATIONS.

1/4 RIBBED


ELASTOMERIC PAD


OTHER MATERIALS, COMPOUNDS, OR FINISHES WITH EQUAL OR SUPERIOR PROPERTIES MAY BE SUBSTITUTED AS THEY BECOME AVAILABLE.

CERTIFIED FOR:	MODEL AW AND AWH-3E 1600-3500 LBS. OPEN SPRING-FLEX MOUNTS 3 INCH		SCALE: NONE	4	<u> </u>
JOB NAME:			SHEET:		- 4
CUSTOMER :		VMC			
CUSTOMER P.O.:	DEFLECTION	GROUP THE POWER OF TOGETHER*	DRAWING NO.:	REV	
SALES ORDER:		Bloomingdale, NJ 07403 Houston, TX 77041			

INSTALLATION INSTRUCTION

- ISOLATORS ARE SHIPPED FULLY ASSEMBLED AND ARE TO BE SPACED AND ARRANGED IN ACCORDANCE WITH INSTALLATION DRAWINGS OR AS OTHERWISE RECOMMENDED.
- 2. SET ISOLATORS ON FLOOR OR SUB-BASE, ENSURING THAT ALL ISOLATOR CENTERLINES MATCH THE EQUIPMENT MOUNTING HOLES OR SPACE AND ARRANGE ISOLATORS IN ACCORDANCE WITH THE INSTALLATION DRAWING. SHIM OR GROUT AS REQUIRED LEVELING ALL ISOLATOR BASE PLATES AT THE SAME ELEVATION (1/4" MAXIMUM DIFFERENCE IN ELEVATION CAN BE TOLERATED). ISOLATOR BASE MUST REST ON A FLAT SURFACE.
- 3. DESIGNATION OF ISOLATORS IS SHOWN ON TAG / LABEL ATTACHED TO EACH ISOLATOR OR ISOLATORS MAY BE IDENTIFIED BY SIZE OF BASE PLATE AND / OR SPRING COLOR CODE.
- 4. IF FLOOR FASTENING IS REQUIRED, PLACE MOUNT AS INDICATED ON NOTE 1 THRU 3 AND ANCHOR USING (2) ANCHOR THRU HOLES "I" ON STEEL PLATE "G" (APPLIES ONLY TO STYLE AWH MOUNT).
- 5. REMOVE JAM NUT "B" FROM ADJUSTING BOLT "A", TURN ADJUSTING NUT "D" COUNTER-CLOCKWISE TO SET "H" FOR ALL ISOLATORS.
- 6. POSITION EQUIPMENT OVER THE ISOLATORS, ALIGN MOUNT ADJUSTING BOLT "A" TO EQUIPMENT BASE MOUNTING THRU HOLES.
- 7. LOWER EQUIPMENT UNTIL IT REST ON ADJUSTING NUT WASHER "C" (SPRING WILL COMPRESS)
- 8. INSERT JAM NUT "B" ON ADJUSTING BOLT "A".
- 9. LEVEL EQUIPMENT BY TURNING ADJUSTING NUT "D" AS REQUIRED
- 10. TIGHTEN JAM NUT "B". INSTALLATION IS COMPLETE

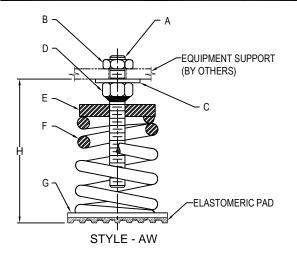

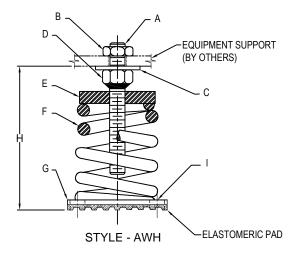

CERTIFIED FOR:			SCALE: NONE		.
JOB NAME:	MODEL AW AND AWH-3E 1600-3500 LBS.		SHEET:	''.'' -\4 5	- 4
CUSTOMER :	OPEN SPRING-FLEX MOUNTS 3 INCH	VMC			
CUSTOMER P.O.:	DEFLECTION	GROUP THE POWER OF TOGETHER*	DRAWING NO.:		REVISIO
SALES ORDER:		Bloomingdale, NJ 07403 Houston, TX 77041			